## **Product Description**

3M<sup>TM</sup> Bonding Film 406 is a flexible, light colored, thermoplastic adhesive bonding film which exhibits good adhesion to a variety of substrates, especially metals.

## **Key Features**

- Consistent, uniform adhesive thickness
- Excellent metal adhesion
- Good solvent resistance

- Quick fixturing/holding strength
- 100% solids
- Reworkable

## **Typical Physical Properties**

**Note:** The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

Base Resin	Ethylene Acrylic Acid Copolymer
Adhesive Thickness	3.0 mil (.003 in.) / 0.08 mm
Liner	None
Color	Translucent
Solids	100%
Ball and Ring Softening Range	300 to 320°F (149 to 160°C)
Tensile Strength @ Break	2600 psi (3.0 mil film)
Elongation @ Break	750% (3.0 mil film)
Two Lb. Dead Load Heat Resistance	200°F (93°C)



## **Application Equipment Suggestions**

**Note:** Appropriate application equipment can enhance bonding film performance. We suggest the following equipment for the user's evaluation in light of the user's particular purpose and method of application.

The type of application equipment used to bond 3M<sup>™</sup> Bonding Film 406 will depend on the application involved and on the type of equipment available for the user. Thin films and flexible substrates can be bonded using a heated roll laminator where heat and pressure can be varied to suit the application. Larger, thicker substrates can be bonded using a heated static press or, in some cases, an autoclave. For applications where a shaped adhesive is to be transferred to a flat or three-dimensional part, a hot shoe or thermode method may be appropriate.

It is recommended that whatever method of bonding the user chooses, the user should determine the optimum bonding conditions using the specific substrates involved.

### **Directions For Use**

To make a bond using 3M<sup>™</sup> Bonding Film 406, the adhesive can be first tacked (lightly bonded) to one of the substrates using low heat, and placing the second substrate to the exposed adhesive surface, making the bond using heat and pressure.

Alternatively, place the adhesive film between the two substrates and make the bond through heat and pressure using a heated press, a hot roll laminator, a hot shoe thermode method or similar equipment.

#### Suggested TACKING Conditions

240°F to 250°F (116°C to 121°C) bondline temperature
1-2 seconds dwell time
5-10 psi pressure

For optimum bonding, heat, pressure and dwell time will depend upon the type and thicknesses of the substrates being bonded together.

A suggested starting point, however, is to use bonding conditions described below.

#### Suggested BEGINNING Bonding Conditions

300°F to 320°F (149°C to 160°C) bondline temperature
2-5 seconds dwell time
10-20 psi pressure

## Directions For Use (continued)

One approach to establishing the optimum bonding conditions for a user's application is to evaluate a series of bonding temperatures, for example 250, 270, 290 and 310°F (121, 132, 143 and 154°C). Time and pressure will be dictated by the thickness of the substrate and the type of substrate being bonded. Thicker substrates and more difficult to bond surfaces will require longer times, higher pressures and/or higher temperatures.

Once the bond is made, the bondline should be allowed to cool somewhat before stress is applied to the bond. Generally, cooling the bondline below 200°F (93°C) is adequate to allow the bonded parts to be unfixtured/unclamped and handled.

For reference, the following table shows typical bond strengths for bonds made at various temperatures. Such a table can be used to evaluate optimum bondline temperatures. It is very important to note that this table is valid only for the specific substrates shown. Varying temperature, pressure, or substrates can affect bond strengths. User should develop a similar table using the specific substrates involved.

**Note:** Temperatures shown are <u>bondline</u> temperatures and not heat block or roll settings!


Peel Adhesion Vs Bonding Temperature			
Bondline Temperature	AL/AL	T-Peel Strength AL/CRS	AL/FR-4
120°F (49°C)	0.2 piw	_	_
130°F (54°C)	0.2 piw	_	<del>_</del>
140°F (60°C)	0.3 piw	_	<del>_</del>
150°F (66°C)	0.5 piw	_	<del>_</del>
160°F (71°C)	1.2 piw	_	<del>_</del>
170°F (77°C)	1.8 piw	_	<del>_</del>
180°F (82°C)	5.0 piw	_	<del>_</del>
190°F (88°C)	5.8 piw	_	<del>_</del>
200°F (93°C)	6.3 piw	_	<del>_</del>
210°F (99°C)	6.8 piw	_	<del>_</del>
220°F (104°C)	7.5 piw	_	<del>_</del>
230°F (110°C)	7.8 piw	_	<del>_</del>
240°F (116°C)	8.1 piw	6.0 piw	1.2 piw
250°F (121°C)	8.2 piw	_	<del>_</del>
255°F (124°C)	_	9.1 piw	1.5 piw
260°F (127°C)	8.4 piw	_	_
270°F (132°C)	8.7 piw	11.1 piw	1.7 piw
280°F (138°C)	9.0 piw	_	<del>_</del>
285°F (141°C)	_	14.3 piw	1.7 piw
290°F (143°C)	9.5 piw	_	<del>_</del>
300°F (149°C)	10.5 piw	13.3 piw	2.3 piw
310°F (154°C)	10.8 piw	_	<del>_</del>
315°F (157°C)	_	17.4 piw	3.4 piw
320°F (160°C)	10.2 piw	_	_
330°F (166°C)	9.8 piw	12.9 piw	4.8 piw
340°F (171°C)	9.7 piw	_	_
345°F (174°C)		12.5 piw	5.2 piw

- · Bonds made using 3 second dwell, 5 lbs gauge pressure.
- Peels done at 90° angle, 2 in/minute, Instron tester.
- · AL is 4.5 mil etched aluminum foil.


## Typical Methods For Bonding 3M™ Bonding Film Adhesives

The following illustrations show several of the many methods that can be used to make bonds using  $3M^{TM}$  Bonding Film Adhesives. Such equipment is generally available commercially or can be built or modified by the user to fit a particular application.


### **Hot Shoe or Thermode Bonding**

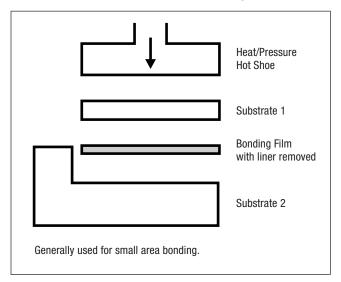


### Oven (Static or Conveyorized) Bonding

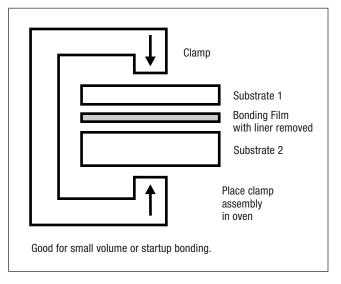

**Hydraulic or Mechanical Press Bonding** 

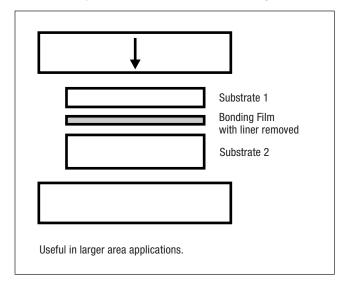

### **Lamination Bonding of Thin Substrates**

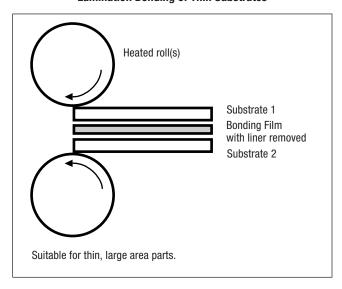

**Debonding** – Since 3M<sup>™</sup> Bonding Film 460 is a thermoplastic material, no curing during heating or aging occurs. To debond or open bonded parts, simply heat the bonded part to an adequate temperature (typically 210-230°F / 99-100°C) to soften the adhesive and then pry or peel the substrates apart.

Solvents, such as acetone, methyl ethyl ketone (MEK), toluene and 3M<sup>™</sup> Citrus Based Cleaner will soften this bonding film adhesive and can be used to remove excess adhesive in unwanted areas.\* Soaking bonds in these solvents can also aid in debonding operations where appropriate.

\*Note: When using solvents, extinguish all ignition sources and follow the manufacturer's precautions and directions for use.

## Typical Performance Characteristics

**Note:** The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

### Overlap Shear Strength to Various Substrates

Test Substrate	Overlap Shear psi	90° Peel piw
Cold Rolled Steel	1160	17.0
Stainless Steel	740	4.4
Aluminum, Etched	1090	16.6
Polycarbonate	70	2.2
Acrylic	260	_
FR-4 PCB	1120	10.0
ABS	_	_
HDPE	_	_
Polypropylene	80	1.3
PVC	_	_
Nylon 6,6	140	3.5
Glass	_	1.9
SBR Rubber	_	12.1
Nitrile Rubber	_	11.7
Polyimide	_	9.2
Polyester	_	_

- Overlap shear made bonding 20 mil aluminum to test substrates using 320°F (160°C) bondline temperature, 2 seconds dwell, 14 lbs gauge pressure.
- · Peel bonds made bonding 4.5 mil aluminum foil to test substrates using 320°F (160°C) bondline temperature, 2 seconds dwell, 14 lbs gauge pressure.
- · Adhesion tests done @ 2 in/minute for peel, .2 in/minute for OLS.

### **Humidity Aging**

Aging Conditions	Time	90° Peel piw
	0 (Control)	15.4
150°F / 95% rh	6 days	16.9
150°F / 95% rh	21 days	17.7
185°F / 95% rh	6 days	16.6
185°F / 95% rh	21 days	16.2

Peel bonds made bonding 4 mil etched aluminum to 63 mil etched aluminum using 320°F (160°C) bondline temperature, 2 seconds dwell, 10 lbs gauge
pressure.

<sup>·</sup> Peel tests @ 2 in/minute.

## Typical Performance Characteristics (continued)

**Note:** The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

### Adhesion Strength **TESTED** at Various Temperatures

Test Temperature	Overlap Shear psi	90° Peel piw
75°F (24°C)	1160	16.5
100°F (38°C)	1090	17.5
125°F (52°C)	990	19.2
150°F (66°C)	910	18.0
175°F (79°C)	590	15.0

<sup>•</sup> Overlap shear made bonding 20 mil etched aluminum to 63 mil etched aluminum using 320°F (160°C) bondline temperature, 2 seconds dwell, 14 lbs gauge pressure.

### **Electrical Data**

	3M™ Bonding Film 406	
Test	Method	Value
Dielectric Constant	ASTM D-257	2.4 @ 1 kilohertz 2.4 @ 10 kilohertz 2.4 @ 100 kilohertz 2.4 @ 1 megahertz
Dissipation Factor	ASTM D-257	.005 @ 1 kilohertz .001 @ 10 kilohertz .001 @ 100 kilohertz .006 @ 1 megahertz
Dielectric Breakdown Strength	ASTM D-149	2300 volts/mil
Volume Resistivity	ASTM D-257	5.9 x 10 <sup>17</sup> ohm-cm

## Storage and Shelf Life

Storage: Store in a dry (preferably <50% RH) location at 35°F (2°C) to 80°F (27°C).

Shelf Life: Shelf life is 2 years from the date of shipment under storage conditions mentioned above.

<sup>·</sup> Peel bonds made bonding 4.5 mil aluminum foil to test substrates using 320°F (160°C) bondline temperature, 2 seconds dwell, 14 lbs gauge pressure.

<sup>·</sup> Adhesion tests done @ 2 in/minute for peel, .2 in/minute for OLS.

## Certification/Recognition

MSDS: 3M has not prepared a MSDS for this product which is not subject to the MSDS requirements of the Occupational Safety and Health Administration's Hazard Communication Standard, 29 C.F.R. 1910.1200(b)(6)(v). When used under reasonable conditions or in accordance with the 3M directions for use, the product should not present a health and safety hazard. However, use or processing of the product in a manner not in accordance with the directions for use may affect its performance and present potential health and safety hazards.

**TSCA:** This product is defined as an article under the Toxic Substances Control Act and therefore, it is exempt from inventory listing requirements.

**RoHS:** This product complies with the requirements of EU Directive 2002/95/EC and 2005/618/EC.

### For Additional Information

To request additional product information or to arrange for sales assistance, call toll free 1-800-251-8634. Address correspondence to: 3M Electronics Markets Materials Division, Building 21-1W-10, 900 Bush Avenue, St. Paul, MN 55144-1000. Our fax number is 651-778-4244 or 1-877-369-2923. In Canada, phone: 1-800-364-3577. In Puerto Rico, phone: 1-787-750-3000. In Mexico, phone: 52-70-04-00.


## Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

## Warranty; Limited Remedy; Limited Liability.

This product will be free from defects in material and manufacture at the time of purchase. 3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.





3M Center, Building 21-1W-10, 900 Bush Avenue St. Paul, MN 55144-1000 1-800-251-8634 phone 651-778-4244 fax www.3M.com/electronics

